

# AIR INDICATORS

**M5 × 0.8, R1/8 (M5 × 0.8)**

- Air Indicators change colors to display the presence or absence of air pressure in pneumatic circuits.
- Air Indicators enable checks of pressurized lines, and of operating status and completion of operation.
- Air Indicators have construction to completely change colors, with sharply contrasting indication.

## Symbol



## Specifications

Item	Model	KIS-R	KIS-G	KIL-R	KIL-G
Port size		M5 × 0.8		R1/8 and M5 × 0.8 (female thread)	
Media		Air			
Operating pressure range	MPa [psi.]	0.15 ~ 0.9 [22 ~ 131]		0.1 ~ 0.7 [15 ~ 102]	
Proof pressure	MPa [psi.]	1.3 [189]			
Operating temperature range	°C [°F]	0 ~ 60 [32 ~ 140]			
Maximum operating frequency	Hz	5		3	
Lubrication		Required			
Color indication	No air pressure	None	None	Green	Red
	Under air pressure	Red	Green	Red	Green
Body material		Brass		Aluminum alloy	
Mass	g [oz.]	5 [0.18]		86 [3.03]	


### Sales unit

KIS is sold in sets of 5 pcs. When ordering, enter "one" for a set of 5 pcs.

KIL is sold as 1 pc.

## Dimensions (mm)

### ● KIS

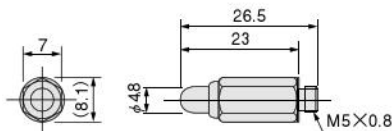

### ● KIL

